

UNCLASSIFIED

~~SECRET~~

~~SECRET~~
COPY

NWSSGR 92-
COF

LTG DRAFT
NOT RELEASED

~~SECRET~~

~~RESTRICTED DATA~~
~~Atomic Energy Act of 1954~~

B57-531

SAFETY PRECAUTIONS

ELECTROSTATIC SENSITIVE DEVICES (ESSD).

The B57 contains ESSD's which are sensitive to static electricity. When these devices are exposed to electrostatic discharge, personnel safety and/or weapon function may be affected. These devices may be either electroexplosive devices (EED) or nonexplosive devices. Failure to equalize body potential with that of the weapon or component, as directed in this manual, may activate or damage the ESSD's. Do not touch the electrical connector pins or connector sockets.

If operations being carried out under ESSD Warnings are interrupted and/or actions are taken that may build up static electricity, personnel must equalize their body potential with that of the weapon or component before resuming operations.

Refer to TP 35-51 for information on Protecting Electrical Connectors.

HAZARDOUS EXPENDABLE MATERIALS.

Procedures in this manual require the use of hazardous expendable materials. These hazardous expendable materials are identified in the text by (HM). The user must be familiar with (or refer to) the Material Safety Data Sheet (MSDS) and applicable OSHA regulations (as implemented by Service policies) for each hazardous expendable material used in the day's operation. The using organization shall determine what, if any, additional protection is required. However, all regulatory standards must be met.

Hazardous expendable materials may be additionally identified in the text by (HM)(F). These materials are flammable. The user must be familiar with (or refer to) the manufacturer's MSDS, OSHA regulations, and local regulations (as implemented by Service policies) for proper use procedures.

~~SECRET~~

B-5

UNCLASSIFIED

~~SECRET~~

UNCLASSIFIED

~~SECRET~~

NWSSGR 92-2

~~SECRET~~

COPY

COPY

~~RESTRICTED DATA
Atomic Energy Act of 1954~~

[REDACTED]

LTG DRAFT
NOT RELEASED

B57-531

SECTION 1

GENERAL

1-1 PURPOSE.

1-1.1 This retrofit order provides procedures to improve shipment safety of B57 bombs.

NOTE

ALT 914 is reversible. Procedures for reversing ALT 914 will either be provided in a technical manual, or the ALT will be reversed by DOE personnel using special repair procedures.

1-1.2 This retrofit will be performed on all B57's before shipment by air.

1-2 COMPLIANCE REQUIREMENTS.

1-2.1 **BY WHOM WORK WILL BE ACCOMPLISHED.** The work required by this retrofit order will be performed by Service and DOE team personnel (where applicable) at all locations having B57's.

1-2.2 **WHEN WORK WILL BE ACCOMPLISHED.** This retrofit will be completed before air shipment of any B57 and following receipt of this manual by the organization possessing the bomb.

1-2.3 **MAN-HOURS REQUIRED.** Retrofit of a single B57 requires approx. 1 hr, not including preparation time.

1-3 RECORDING AND REPORTING REQUIREMENTS.

Accomplishment of this retrofit will be reported and recorded using appropriate Service procedures. For Navy, refer to SWOP 1-2.

[REDACTED]

B-7

~~SECRET~~

UNCLASSIFIED

~~SECRET~~

UNCLASSIFIED

~~SECRET~~
COPY

NWSSGR 92-2
COPY

LTG DRAFT
NOT RELEASED

[REDACTED]

~~RESTRICTED DATA~~
~~Atomic Energy Act of 1954~~

B57-531

1-4 PROJECT NUMBER

1-4.1 The project number for this retrofit is Product Change Proposal number 2-92.

1-4.2 Reporting will reference TP B57-531.

1-5 WEIGHT AND BALANCE INFORMATION.

The weight and balance change resulting from performance of this retrofit is negligible.

~~SECRET~~

[REDACTED]

UNCLASSIFIED

~~SECRET~~

UNCLASSIFIED

~~SECRET~~
COPY

NWSSGR 92-
COP

~~RESTRICTED DATA~~
Atomic Energy Act of

[REDACTED]

LTG DRAFT
NOT RELEASED

B57-531

SECTION 2

SUPPLY DATA

2-1 TP MANUAL.

Performance of this retrofit requires reference to TP B57-1.

2-2 PARTS AND MATERIALS.

2-2.1 STENCILING MATERIALS. Service will provide materials required for stenciling ALT number (par. 3-3.1).

2-2.2 OTHER PARTS AND MATERIALS. The DOE team will furnish all other parts and materials required to perform this retrofit. Table 2-1 lists connector covers required to perform the retrofit, and table 2-2 lists required expendable materials.

2-3 TOOLS AND EQUIPMENT.

2-3.1 SERVICE PERSONNEL. Refer to Special Equipment listing in TP B57-1 for tools required to perform this retrofit.

2-3.2 DOE TEAM. The DOE team will equip themselves with tools and materials required to perform procedures in par. 3-2.

2-4 DISPOSITION OF REMOVED PARTS.

No parts are removed from the B57 when performing this retrofit.

[REDACTED]

3

~~SECRET~~

B-9

UNCLASSIFIED

~~SECRET~~

LTG DRAFT
NOT RELEASED

[REDACTED]

~~RESTRICTED DATA~~
~~Atomic Energy Act~~

B57-531

TABLE 2-1

CONNECTOR COVERS

ITEM	PART NO.	QUANTITY

TABLE 2-2

EXPENDABLE MATERIALS

ITEM NUMBER	NOMENCLATURE
299	Lacquer (black lusterless) (HM)(F)
532	Textile tape

[REDACTED]

~~RESTRICTED DATA~~
~~Atomic Energy Act of 1954~~

~~[REDACTED]~~

LTG DRAFT
NOT RELEASED

B57-531

SECTION 3

MODIFICATION DATA

3-1 PRELIMINARY OPERATIONS.

NOTE

- This retrofit is performed (where applicable) with B57's in two-high stack in H1012 Hand Truck. Do not unstack bombs.
- Service personnel perform procedures in section 3-1.

3-1.1 MONITOR READY-SAFE SWITCH. Check position of ready-safe switch by looking through forward observation window in center bomb subassembly. The ready-safe switch should be in S (green) position. If ready safe-switch is in R (red) position, remove SEP (par. 3-1.2), if installed, and reject B57.

3-1.2 REMOVE MC1386 STRIKE-ENABLING PLUG (SEP). Check for presence of SEP by looking through aft observation window in center bomb subassembly. If SEP is installed, remove it as follows.

- Remove observation window assembly using 1-1/4-in. socket wrench installed on inverted nut.
- Grasp SEP and pull out to remove.
- Reinstall observation window and tighten securely.

NOTE

SEP is not reinstalled as long as bomb remains ALT 914.

- Package SEP according to TP B57 procedures for Packaging Strike-Enabling Plug.

~~[REDACTED]~~

B-11

UNCLASSIFIED

~~SECRET~~

NWSSGR 92-2

~~SECRET~~
COPY


COPY

LTG DRAFT
NOT RELEASED

~~SECRET~~

~~RESTRICTED DATA~~
~~Atomic Energy Act of 1954~~

B57-531

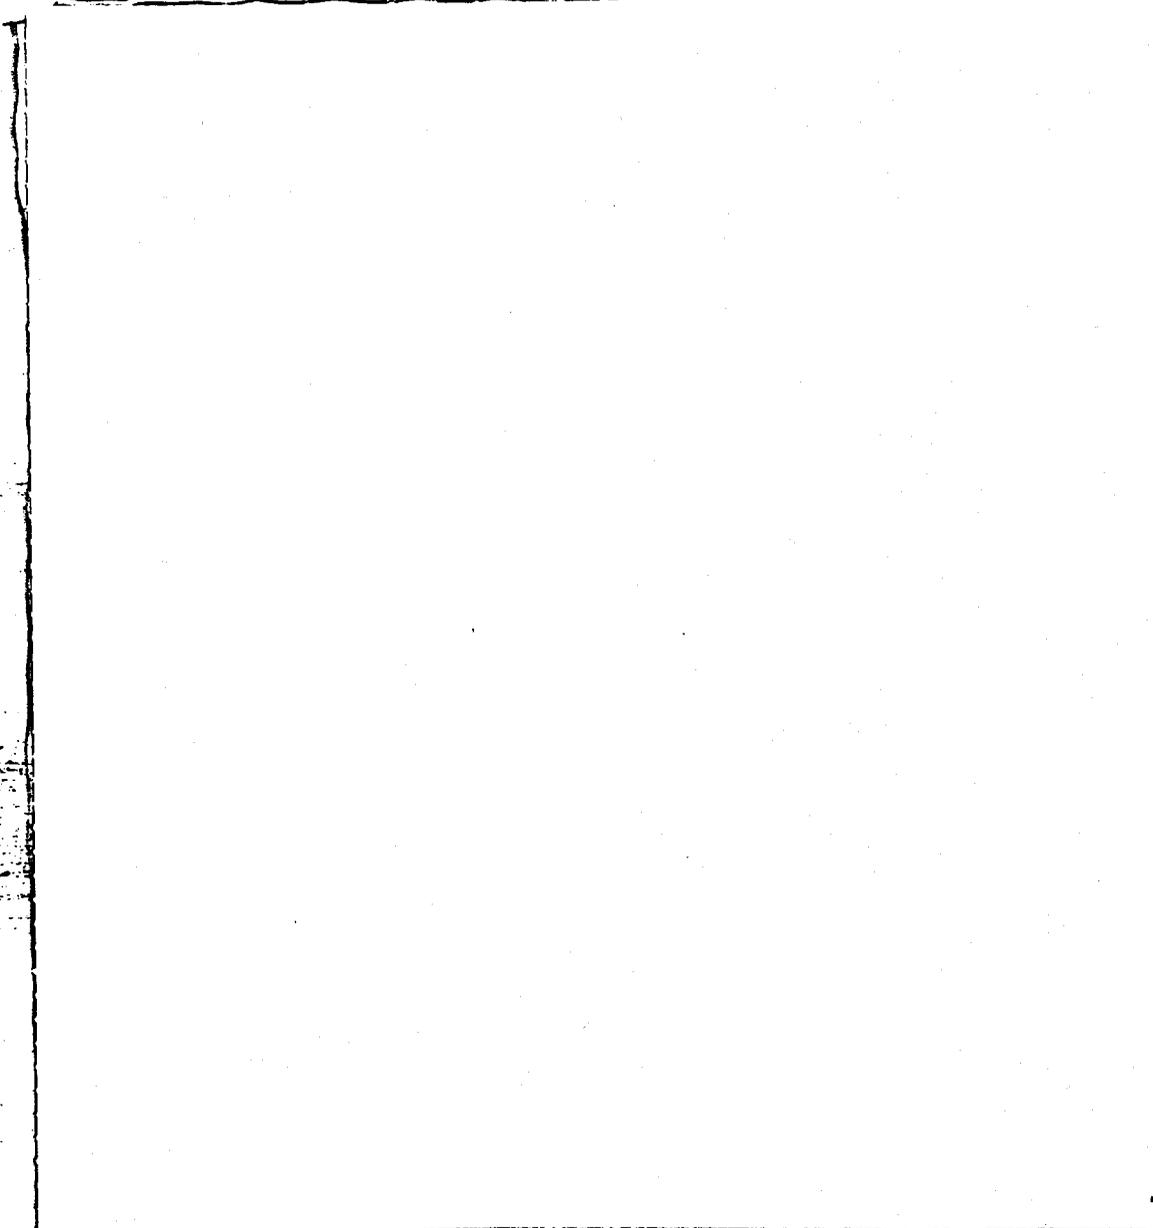

Do
bc

6

~~SECRET~~

B-12

UNCLASSIFIED

~~SECRET~~

UNCLASSIFIED

~~SECRET~~
COPY

NWSSGR 92-2
COPY

LTG DRAFT
NOT RELEASED

~~RESTRICTED DATA~~
~~Atomic Energy Act~~

B57-531

NOTE

Following actions are based on assumption there was a build up of tritium in the center bomb subassembly.

(2) If breathing zone levels exceed $50 \mu\text{Ci}/\text{m}^3$, but are less than $500 \mu\text{Ci}/\text{m}^3$, reinstall access panel (par. 3-2.4), retreat from the immediate area, and continue to monitor bunker atmosphere. Observe monitors from a distance to determine if tritium concentration is decreasing. When tritium concentration becomes less than $50 \mu\text{Ci}/\text{m}^3$, reenter area and again remove access panel. If tritium concentration again exceeds $50 \mu\text{Ci}/\text{m}^3$, but does not increase rapidly, leave panel off and allow center bomb subassembly to ventilate. Resume operations when ventilation reduces levels below $50 \mu\text{Ci}/\text{m}^3$.

(3) If breathing zone levels increase rapidly and exceed $500 \mu\text{Ci}/\text{m}^3$, evacuate area immediately (do not reinstall access panel). From a distance, observe whether tritium concentration is still increasing. If it is, evacuate the bunker and allow time for the tritium to ventilate.

3-2.2 REMOVE ACCESS PANEL. Perform the following.

- a. Remove eight machine screws that secure access panel door to center bomb subassembly.
- b. Remove access door and gasket. Use tools for tapping and prying as required. Retain screws, door, and gasket for reinstallation.

3-2.3 DISCONNECT CABLES. Perform the following.

WARNING

Failure to equalize body potential where indicated, or touching connector sockets, may activate an ESSD and cause personal injury or loss of life. This warning applies to procedures in steps b through g. Reequalization is required after interruption of procedures.

- a. Equalize body potential with that of center bomb subassembly by touching bare metal inside access area.
- b. Disconnect P15 of MC181- Interconnecting Box pigtail (P13 on Mod 1, ALT 259) from J2 of MC1391 Thermal Fuse Pack (fig. 3-2). Use connector pliers as necessary.

8

B-14

UNCLASSIFIED

~~SECRET~~

UNCLASSIFIED

~~SECRET~~

NWSSGR 92-2
COPY

~~SECRET RESTRICTED DATA~~
COPY

LTG DRAFT
NOT RELEASED

[REDACTED]

~~RESTRICTED DATA~~
Atomic Energy Act of 1954

B57-531

THIS PAGE INTENTIONALLY LEFT BLANK

10

~~SECRET~~

[REDACTED]

B-16

UNCLASSIFIED

~~SECRET~~

